TACAN RWY 26

TACAN	APCH CRS	Rwy ldg	TDZE	Arpt Elev
GSB Chan 112	261°	11,760	109	109

AL-169 [USAF] SEYMOUR JOHNSON AFB (KGSB)

* When ALS inop, increase CAT AB RVR to 50 and vis to 1mile, CAT C vis to 1½ miles, CAT D vis to 1¾ miles, CAT E vis to 2 miles.
** Circling N of Rwy 8-26 not authorized.

ALSF-1

MISSED APPROACH: Climb to 2200 via GSB R-261 to 12 DME (TULME) and hold.

ATIS ★	SEYMOUR JOHNSON APP CON	SEYMOUR JOHNSON TOWER ★	GND CON	CLNC DEL
317.625	258°-110° 123.7 290.9 111°-257° 119.7 273.6	126.25 370.875	138.1 275.8	128.025 270.8

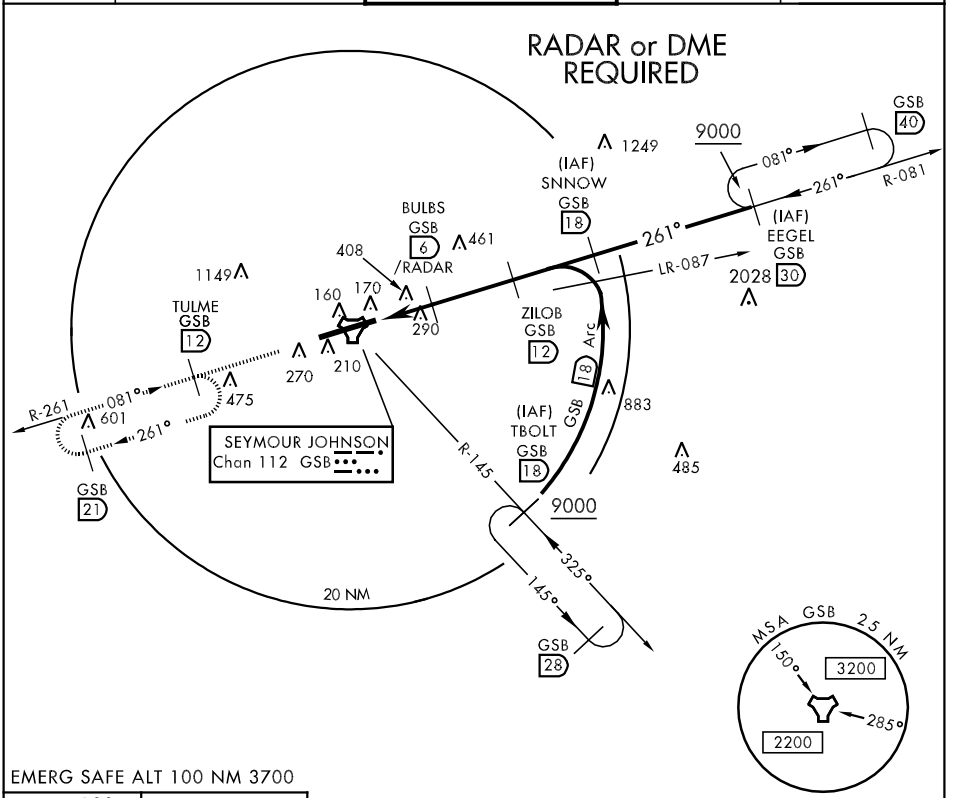

EMERG SAFE ALT 100 NM 3700

ELEV 109

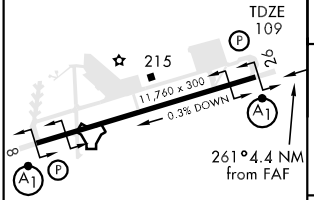

HIRL Rwy 8-26

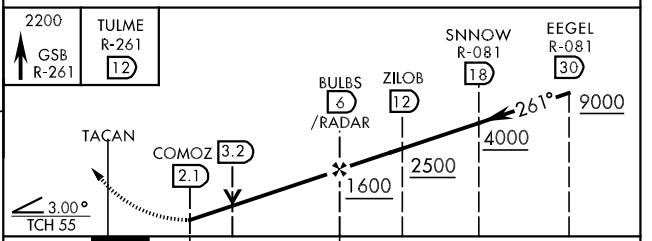

FAF to MAP 3.9 NM					
Knots	60	90	120	150	180
Min:Sec	3:54	2:36	1:57	1:34	1:18

CATEGORY	A	B	C	D	E
S- 26*	680/24	571 (600-½)	680/50 571(600-1)	680/60 571 (600-1¼)	680-1½ 571 (600-1½)
CIRCLING **	680-1	571 (600-1)	680-1½ 571 (600-1½)	680-2 571(600-2)	740-2¼ 631(700-2¼)

SE-2, 22 OCT 2009 to 19 NOV 2009
SE-2, 22 OCT 2009 to 19 NOV 2009