VORTAC BDL	APP CRS	Rwy ldg	9509
109.0	240°	TDZE	171
Chan 27		Apt Elev	174

VOR or TACAN RWY 24

WINDSOR LOCKS / BRADLEY INTL (BDL)

For inoperative MALSR increase S-24 CAT D and E RVR to 6000.

MALSR

MISSED APPROACH: Climb to 3000 via BDL R-236 to DITTI Int/BDL 10 DME and hold.

ATIS	BRADLEY APP CON	BRADLEY TOWER	GND CON	CLNC DEL
118.15	127.225 323.2	120.3 351.8	121.9 348.6	121.75 322.3

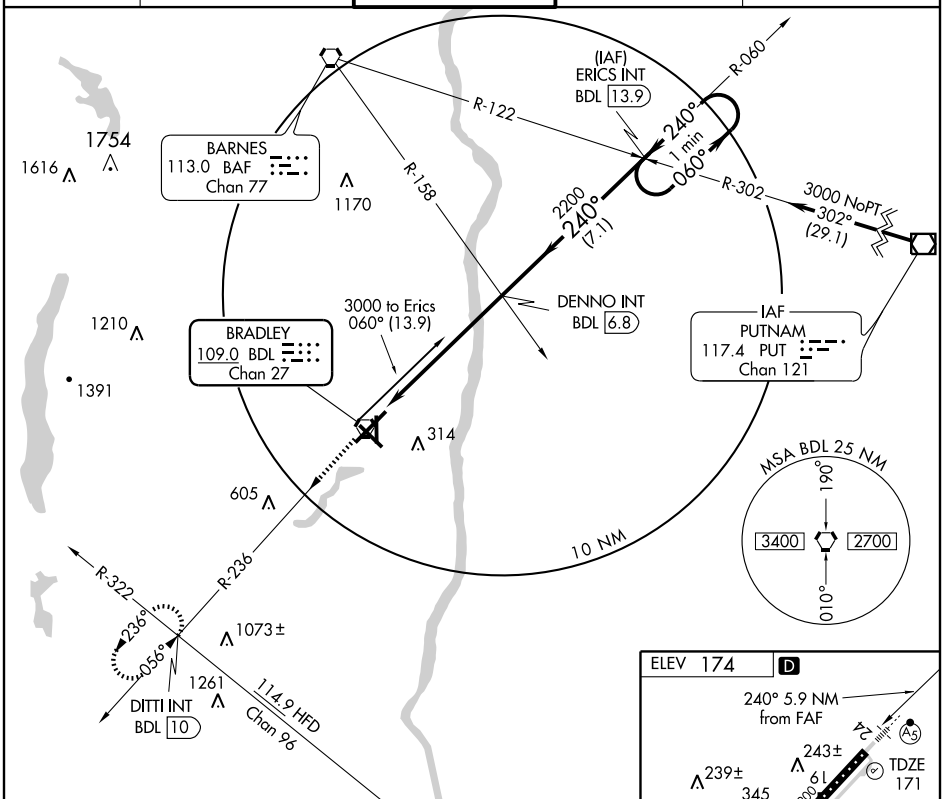

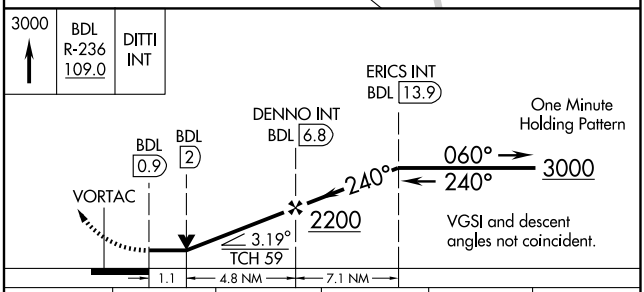

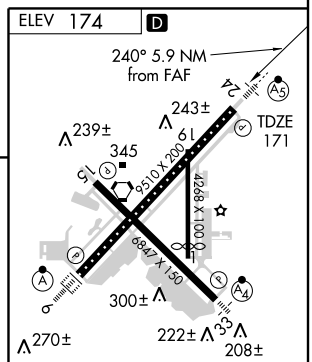

TDZ/CL Rwy 6 and 24
HIRL Rwys 6-24 and 15-33
MIRL Rwys 1-19
REIL Rwy 15

CATEGORY	A	B	C	D	E
S-24	560/24 389 (400-½)			560/50 389 (400-1)	
CIRCLING	680-1 506 (600-1)		680-1½ 506 (600-1½)	1100-3 926 (1000-3)	1380-3 1206 (1300-3)

FAF to MAP 5.9 NM					
Knots	60	90	120	150	180
Min:Sec	5:54	3:56	2:57	2:22	1:58

NE-1, 22 OCT 2009 to 19 NOV 2009

NE-1, 22 OCT 2009 to 19 NOV 2009