LOC I-CEW	APP CRS	Rwy Idg	8005
111.9	171°	TDZE	213
		Apt Elev	213

ILS or LOC RWY 17
CRESTVIEW/BOB SIKES (CEW)

If local altimeter setting not received, use Eglin AFB altimeter setting and increase all DA's and MDA's 60 feet.
Autopilot coupled approach not authorized. ADF REQUIRED.

MISSED APPROACH: Climb to 1000 then climbing right turn to 2000 direct CE LOM and hold.

ASOS	EGLIN APP CON ★	UNICOM
119.275	124.05 284.65	122.95 (CTAF) L

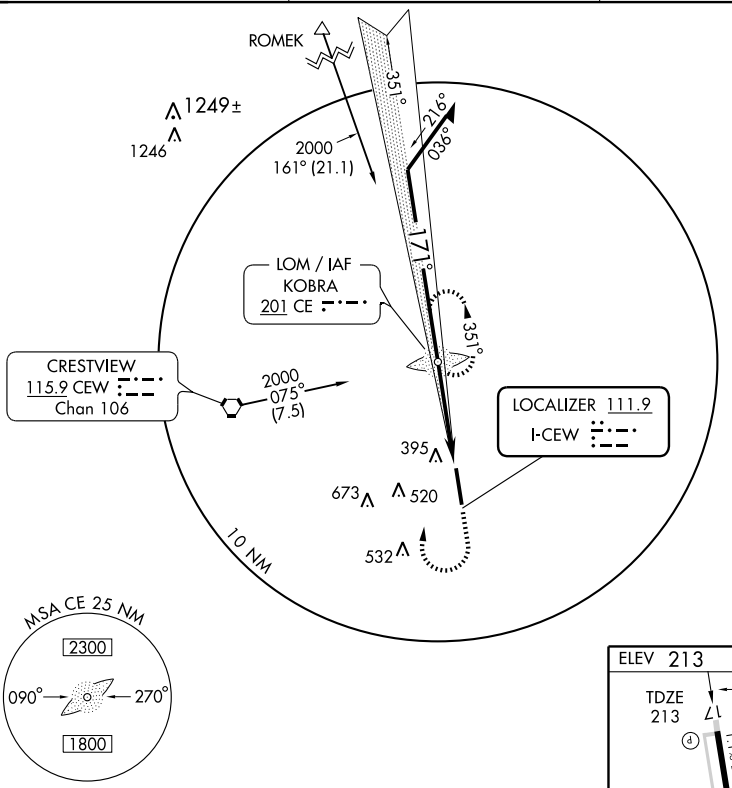

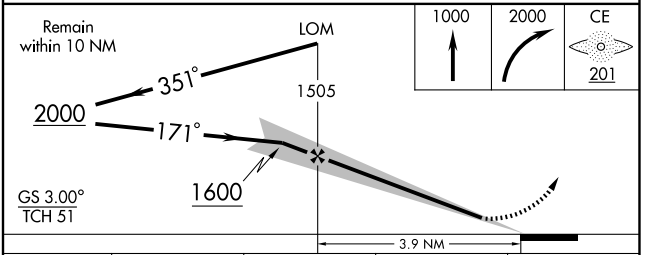

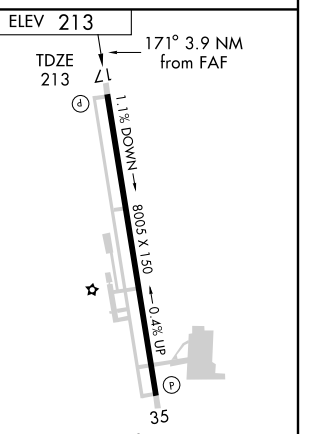

MIRL Rwy 17-35 L

CATEGORY	A	B	C	D
S-ILS 17	413-¾ 200 (200-¾)			
S-LOC 17	640-1 427 (500-1)		640-1¼ 427 (500-1¼)	
CIRCLING	700-1 487 (500-1)		700-1½ 487 (500-1½)	820-2 607 (700-2)

FAF to MAP 3.9 NM

Knots	60	90	120	150	180
Min:Sec	3:54	2:36	1:57	1:34	1:18

SE-3, 22 OCT 2009 to 19 NOV 2009
SE-3, 22 OCT 2009 to 19 NOV 2009