| LOC I-HSV | APP CRS | Rwy ldg | 12600 |
|---|---|---|---|
| 109.3 | 182° | TDZE | 629 |
| | | Apt Elev | 629 |

# ILS RWY 18R (CAT II)

## HUNTSVILLE INTL-CARL T. JONES FIELD (HSV)

ASR

Cat II minimums NA when Control Tower closed.

ALSF-2

MISSED APPROACH: Climb to 1300 then climbing right turn to 3000 direct DCU VOR/DME and hold.

| ATIS | HUNTSVILLE APP CON ★ | HUNTSVILLE TOWER ★ | GND CON | CLNC DEL | UNICOM |
|---|---|---|---|---|---|
| 121.25 | 125.6 354.1 | 127.6 (CTAF) L 350.35 | 121.9 269.525 | 120.35 | 122.95 |

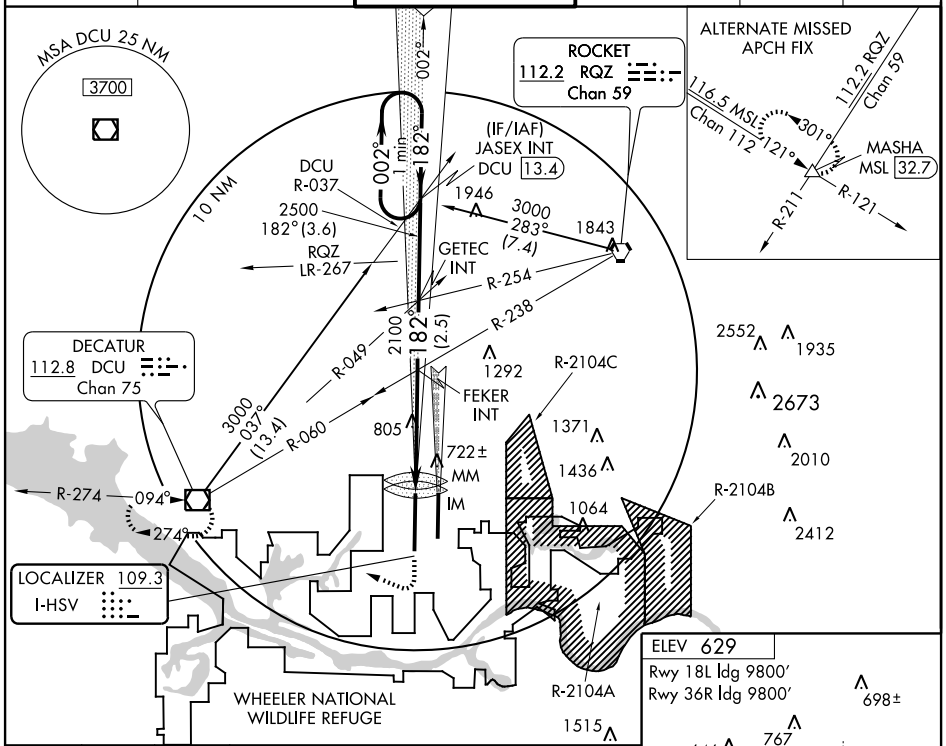


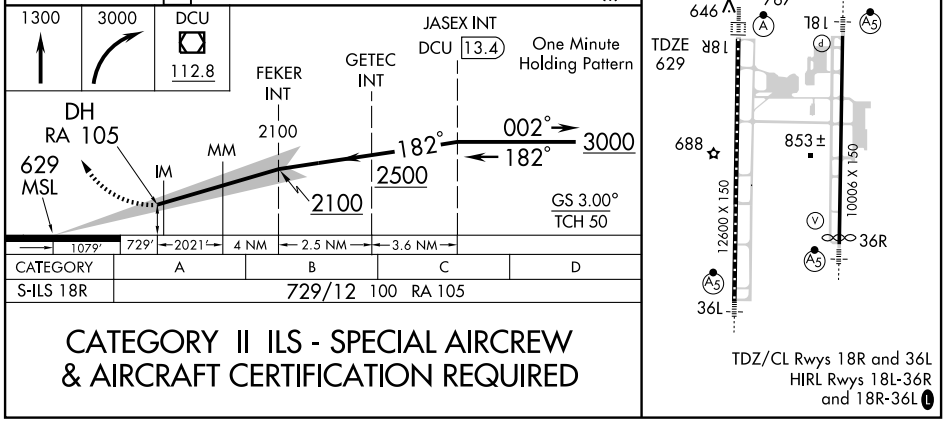


| CATEGORY | A | B | C | D |
|---|---|---|---|---|
| S-ILS 18R | 729/12 100 RA 105 | | | |

**CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED**

SE-4, 22 OCT 2009 to 19 NOV 2009

SE-4, 22 OCT 2009 to 19 NOV 2009