WAAS	APP CRS	Rwy Idg	12102
CH 62811	230°	TDZE	739
W23A		Apt Elev	744

RNAV (GPS) RWY 23L

COLUMBUS / RICKENBACKER INTL (LCK)

Circling NA NW of Rwy 5L-23R. Baro-VNAV NA when using Port Columbus Intl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C (4°F) or above 47°C (116°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Port Columbus Intl altimeter setting and increase all DA 36 feet and LNAV/VNAV all Cats visibility to RVR 5000, increase all MDA 40 feet.

MALSR

MISSED APPROACH: Climb to 3000 direct YERKU and hold.

AWOS-3	COLUMBUS APP CON	RICK TOWER	GND CON	UNICOM
132.75	119.15 279.6	120.05 348.4	121.85 275.8	122.95

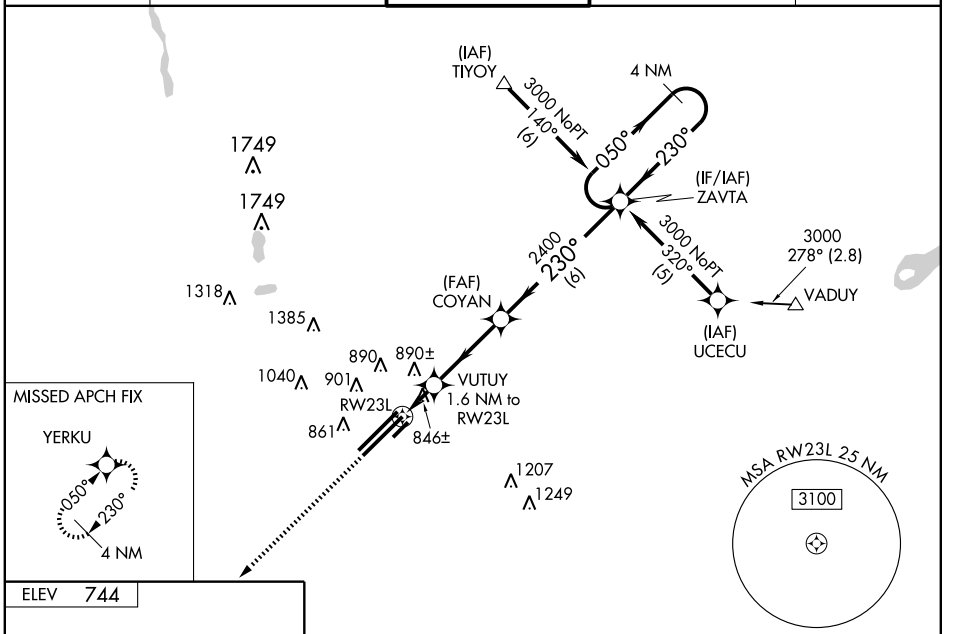

ELEV 744

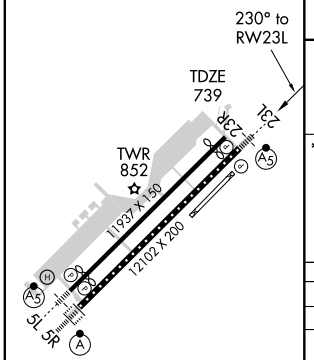

TDZ/CL Rwy 5R
REIL Rwy 23R
HIRL Rwys 5L-23R and 5R-23L

3000 YERKU

VGSI and RNAV glidepath not coincident.

* LNAV only

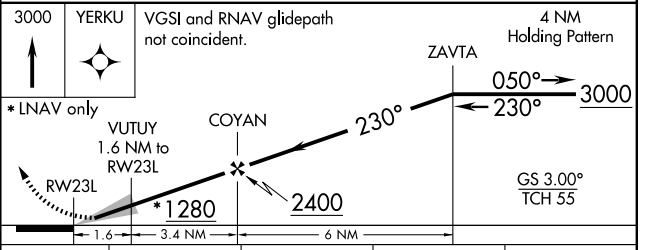

CATEGORY	A	B	C	D
LPV DA	939/24 200 (200-½)			
LNAV/VNAV DA	1121/40 382 (400-¾)			
LNAV MDA	1180/24 441 (500-½)		1180/40 441 (500-¾)	1180/50 441 (500-1)
CIRCLING	1180-1 436 (500-1)	1200-1 456 (500-1)	1200-1½ 456 (500-1½)	1300-2 556 (600-2)

EC-2, 22 OCT 2009 to 19 NOV 2009

EC-2, 22 OCT 2009 to 19 NOV 2009