

NDB RWY 23L

COLUMBUS / RICKENBACKER INTL (LCK)


| | | |
|----------------------|------------------------|-------------------------|
| LOM LC 376 | APP CRS 231° | Rwy Idg 12102 |
| | | TDZE 739 |
| | | Apt Elev 744 |

⚠ Circling NA NW of Rwy 5L-23R.
When local altimeter setting not received, use Port Columbus Intl altimeter setting and increase all MDA 40 feet.

MALSR
AS





MISSED APPROACH: Climb to 3000 then left turn direct XUB VOR and hold.

| | | | | |
|-------------------------|---|-----------------------------------|--------------------------------|-------------------------|
| AWOS-3 132.75 | COLUMBUS APP CON 119.15 279.6 | RICK TOWER 120.05 348.4 | GND CON 121.85 275.8 | UNICOM 122.95 |
|-------------------------|---|-----------------------------------|--------------------------------|-------------------------|

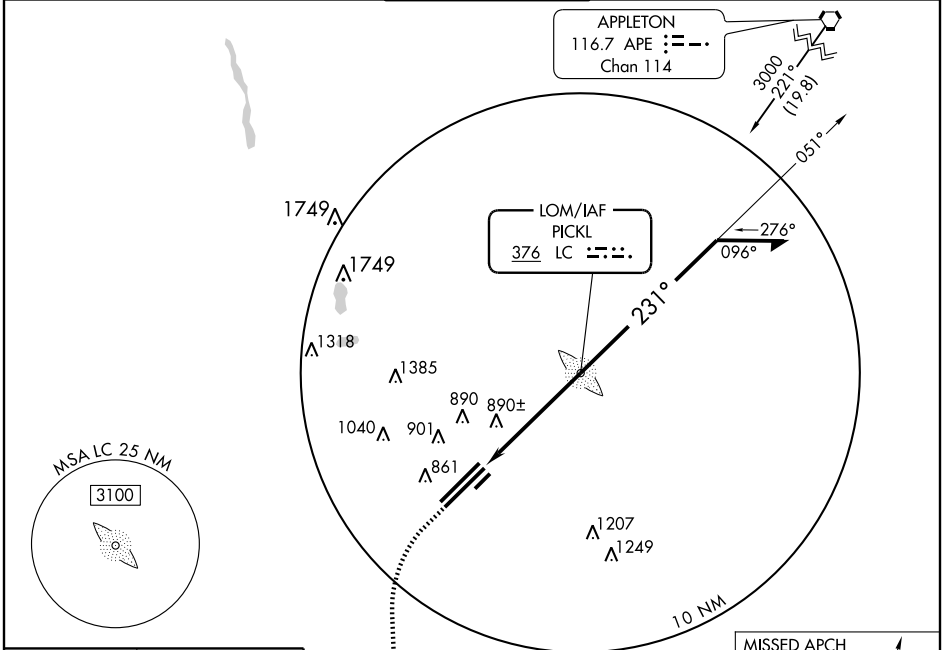

EC-2, 22 OCT 2009 to 19 NOV 2009

EC-2, 22 OCT 2009 to 19 NOV 2009

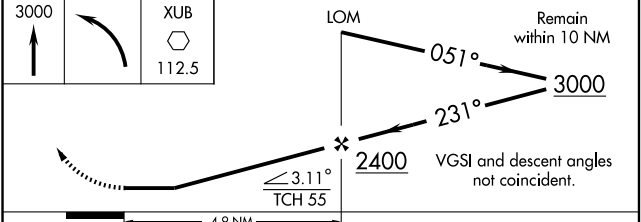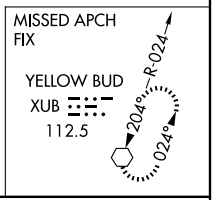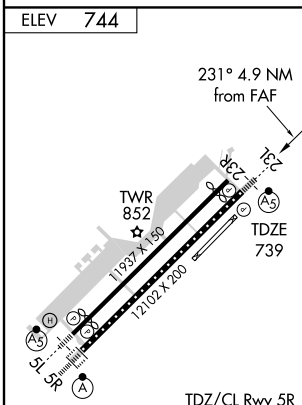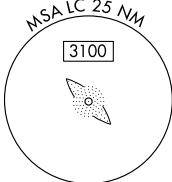

| CATEGORY | A | B | C | D |
|----------|-----------------------|-------------|----------------------------|----------------------------|
| S-23L | 1280/40 541 (600-3/4) | | 1280/50 541 (600-1) | 1280-1 1/2 541 (600-1 1/2) |
| CIRCLING | 1280-1 | 536 (600-1) | 1280-1 1/2 536 (600-1 1/2) | 1300-2 556 (600-2) |