


VOR RWY 9L

WEST PALM BEACH/PALM BEACH INTL (PBI)

VORTAC PBI 115.7 Chan 104	APP CRS 101°	Rwy Idg TDZE Apt Elev	8800 19 19
---	------------------------	-----------------------------	---------------------------------------


For inoperative MALSR, increase AMFAP DME fix minimums S-9 Cat. D visibility to RVR 6000.	MALSR	MISSED APPROACH: Climb to 1000 then climbing right turn to 2000 via PBI R-189 to LANCH Int/10 DME and hold.

ATIS 123.75	PALM BEACH APP CON 124.6 317.4	PALM BEACH TOWER 119.1 257.8	GND CON 121.9 257.8	CLNC DEL 121.6
-----------------------	--	--	-------------------------------	--------------------------

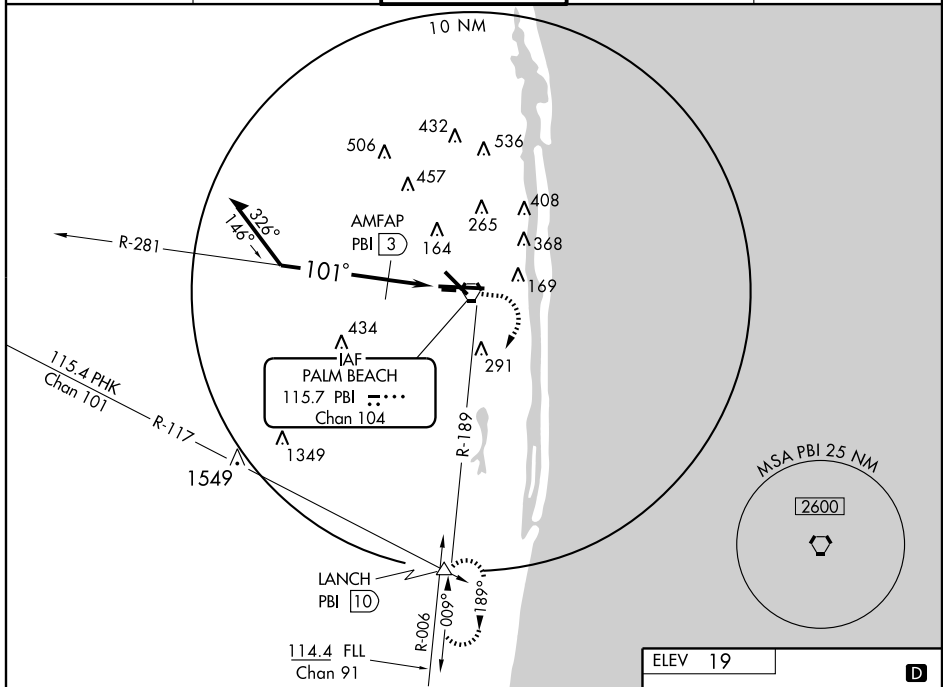

SE-3, 22 OCT 2009 to 19 NOV 2009

SE-3, 22 OCT 2009 to 19 NOV 2009

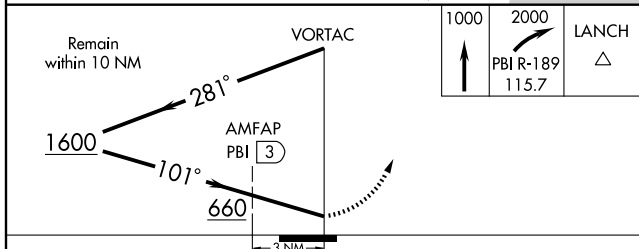

CATEGORY	A	B	C	D
S-9L	660/24	641 (700-1/2)	660/60 641 (700-1/4)	660-1 1/2 641 (700-1/2)
CIRCLING	660-1	641 (700-1)	660-1 3/4 641 (700-3/4)	680-2 661 (700-2)
AMFAP DME FIX MINIMUMS				
S-9L	440/24	421 (500-1/2)	440/40 421 (500-3/4)	440/50 421 (500-1)
CIRCLING	500-1	481 (500-1)	640-1 3/4 621 (700-1 3/4)	680-2 661 (700-2)

ELEV 19	D
---------	----------