


VORTAC RID 110.6 Chan 43	APP CRS 260°	Rwy Idg TDZE Apt Elev N/A N/A 867
----------------------------------------------	------------------------	-----------------------------------------------------------------------

▽ If local altimeter setting not received, use James M. Cox Dayton Intl, OH altimeter setting and increase all MDAs 140 feet.
△ NA


MISSED APPROACH: Climbing right turn to 2700 direct RID VORTAC and hold.

AWOS-3 118.325	DAYTON APP CON 134.45 352.05	GCO 121.725	UNICOM 122.8 (CTAF)
--------------------------	----------------------------------------	-----------------------	-------------------------------


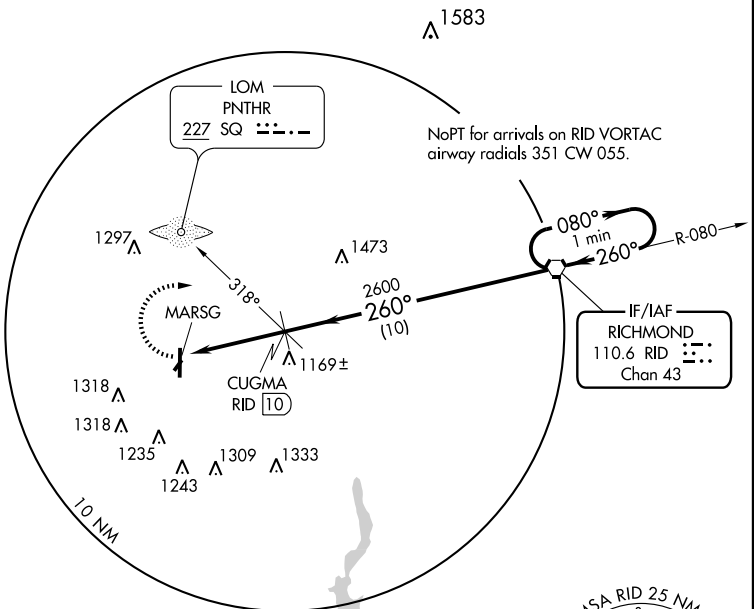


EC-2, 22 OCT 2009 to 19 NOV 2009

EC-2, 22 OCT 2009 to 19 NOV 2009

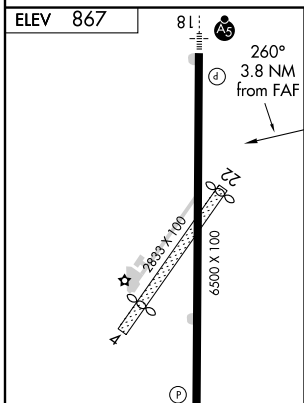

ADF or DME REQUIRED

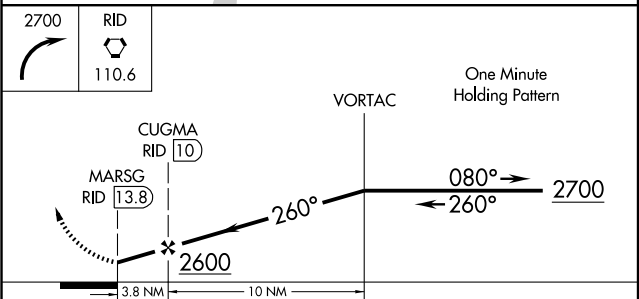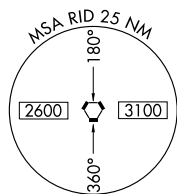

FAF to MAP 3.8 NM					
Knots	60	90	120	150	180
Min:Sec	3:48	2:32	1:54	1:31	1:16

CATEGORY	A	B	C	D
CIRCLING	1420-1	553 (600-1)	1440-1 ½ 573 (600-1 ½)	1680-2 ¾ 813 (900-2 ¾)