

ILS RWY 16R (CAT II)


SACRAMENTO INTL (SMF)

| | | |
|--|------------------------|------------------------|
| LOC/DME I-SMF 111.1 Chan 48 | APP CRS 166° | Rwy Idg 8600 |
| | | TDZE 25 |
| | | Apt Elev 27 |





MISSED APPROACH: Climb to 500, then climbing right turn to 2000 via heading 350° and SAC R-329 to GRIME Int/SAC 35.2 DME and hold.

| | | | | |
|-----------------------|---|-------------------------------------|-------------------------|--------------------------------|
| ATIS 126.75 | NORCAL APP CON (W-N) 134.8 270.25 (NE) 125.4 259.1 (S-SW) 125.25 257.9 (E-SE) 127.4 317.5 | CAPITAL TOWER 125.7 256.7 | GND CON 121.7 | CLNC DEL 121.1 256.7 |
|-----------------------|---|-------------------------------------|-------------------------|--------------------------------|

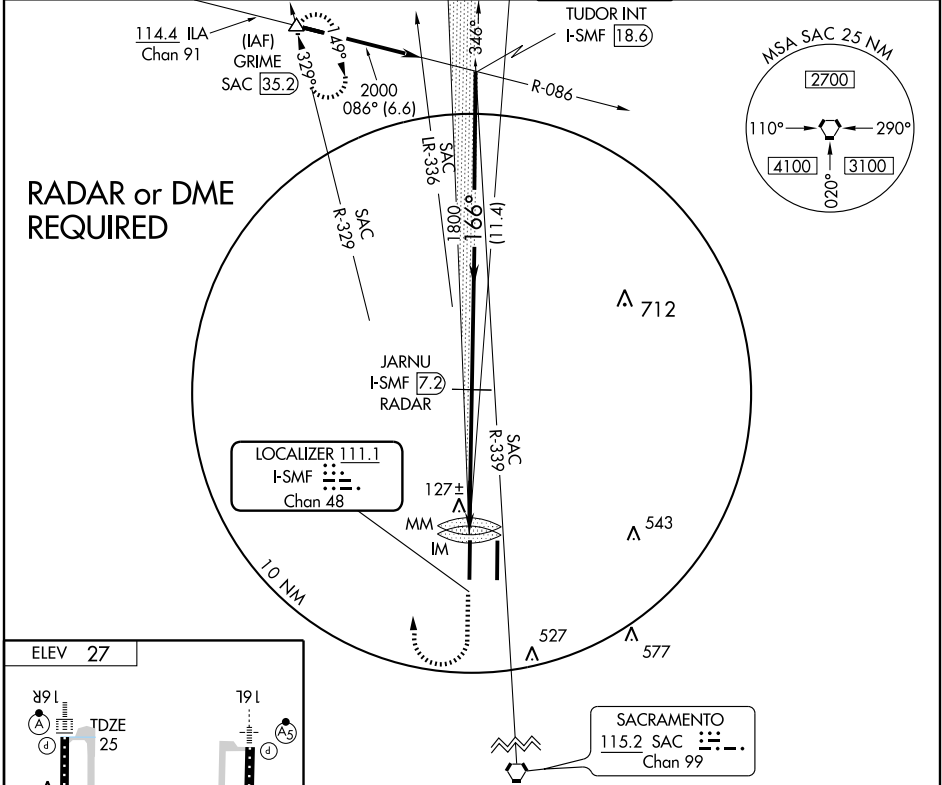

SW-2, 22 OCT 2009 to 19 NOV 2009

SW-2, 22 OCT 2009 to 19 NOV 2009

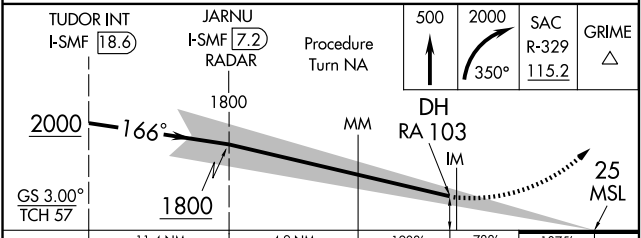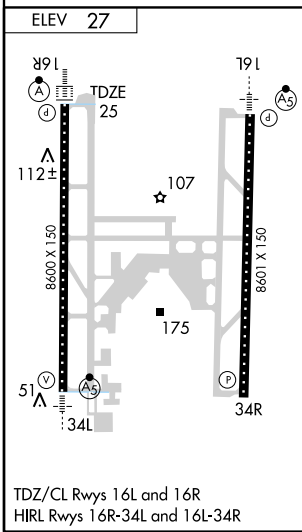

| | | | | |
|-----------|---|--------|------------|---|
| CATEGORY | A | B | C | D |
| S-ILS 16R | | 125/12 | 100 RA 103 | |

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED