

HENDERSON, TEXAS

AL-6358 (FAA)

| | | | |
|---------------------------------------|------------------------|-----------------------------|--------------------------------------|
| VORTAC GGG 112.3 Chan 70 | APP CRS 190° | Rwy Idg TDZE Apt Elev | NA NA 442 |
|---------------------------------------|------------------------|-----------------------------|--------------------------------------|

VOR/DME-A


HENDERSON/ RUSK COUNTY (R.F.I)

▽ Use East Texas Rgnl altimeter setting; when not received, procedure not authorized.

△ NA



MISSED APPROACH: Climb to 1800 then climbing left turn to 2500 via heading 045° and GGG R-172 to PIPES Int/14 DME and hold.

| | | |
|--------------------------|-------------------------------------------|-------------------------------|
| AWOS-3 119,375 | LONGVIEW APP CON ★ 118.25 270.3 | UNICOM 122.8 (CTAF) |
|--------------------------|-------------------------------------------|-------------------------------|

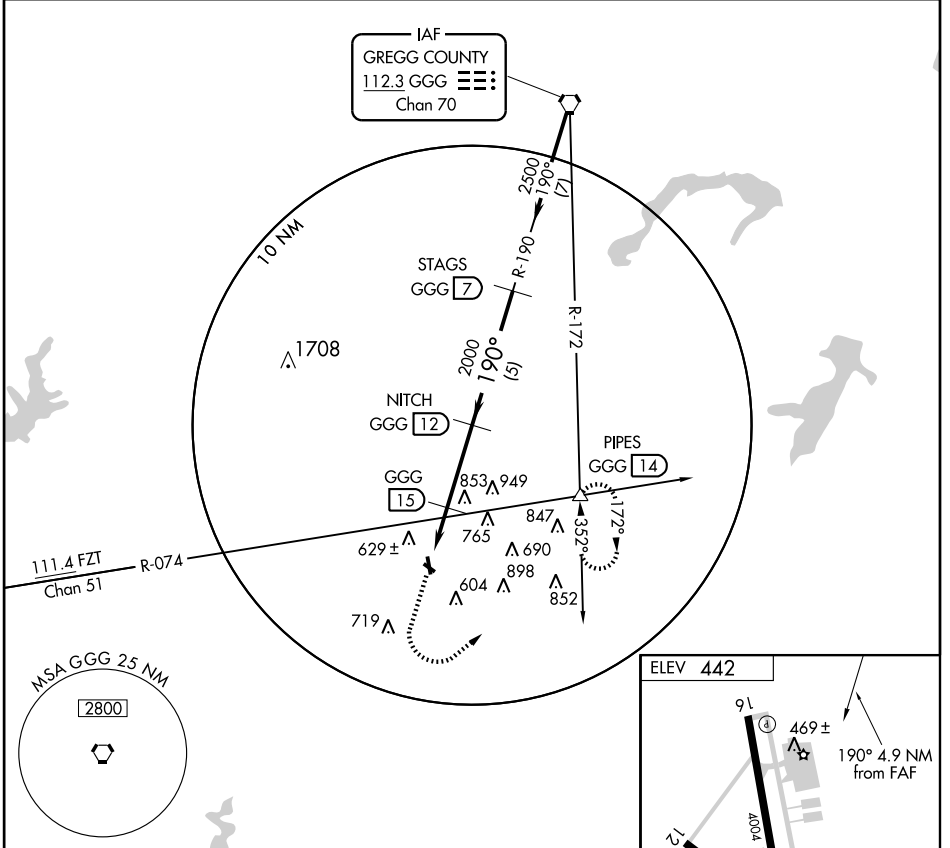

SC-2, 22 OCT 2009 to 19 NOV 2009

SC-2, 22 OCT 2009 to 19 NOV 2009

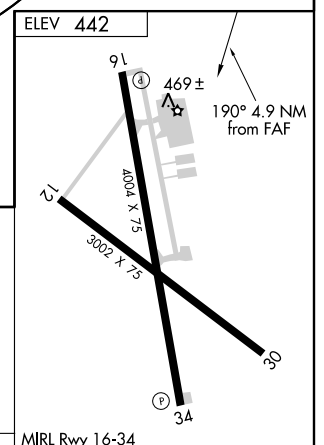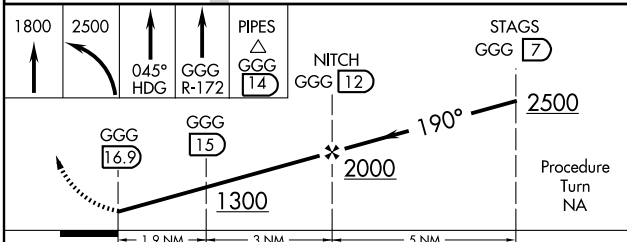

| | | | | | |
|----------|-----------------------|-------------------------|-------------------------|----|---------------------------------------|
| CATEGORY | A | B | C | D | Knots 60 90 120 150 180 Min:Sec |
| CIRCLING | 1220-1 778 (800-1) | 1220-1½ 778 (800-1½) | 1220-2¼ 778 (800-2¼) | NA | |

HENDERSON, TEXAS
Amdt 3B 08325

32° 09' N-94° 51' W

HENDERSON/ RUSK COUNTY (R.F.I)
VOR/DME-A